United States Department of the InteriorNational Park Service

RECEIVED

National Register of Historic Places Registration Form

SEP 2 8 1988

NATIONAL REGISTER

This form is for use in nominating or requesting determinations of eligibility for individual properties or districts. See instructions in *Guidelines* for Completing National Register Forms (National Register Bulletin 16). Complete each item by marking "x" in the appropriate box or by entering the requested information. If an item does not apply to the property being documented, enter "N/A" for "not applicable." For functions, styles, materials, and areas of significance, enter only the categories and subcategories listed in the instructions. For additional space use continuation sheets (Form 10-900a). Type all entries.

1. Name of Property							
historic name	Catalpa	Farm					
other names/site number							S-408
2. Location							
street & number			<u>ne-West</u>	over Road		not for pul	blication
city, town	Princess					X vicinity	
state Maryland	code	MD	county	Somerset	code	039 z ip	code 21853
3. Classification							
Ownership of Property		Category	of Property		Number of Re	sources within P	roperty
X private		X buildin			Contributing	Noncontribu	• •
public-local		district	•		6		ildings
public-State		site				sit	•
public-Federal		structu	re		1		uctures
pasiio i odora.		object					jects
					7		₹
Name of related multiple pro	nerty lieting	•			Number of co	ntributing resour	
N/A	porty listing	•				lational Register	
			-		113100 111 1110 1		
4. State/Federal Agency	Certificat	ion					
State or Federal agency and Signature of commenting or State or Federal agency and	STATE H bureau y meets other official	does r	PRESER	e National Reg	ister criteria. S		eet. 8-88
5. National Park Service	Certificat	ion					
I, hereby, certify that this pro			<u> </u>			··· ·	
entered in the National R See continuation sheet. determined eligible for the Register. See continuated determined not eligible for National Register.	egister. Pational ion sheet. r the		(371)	ik Are	lus		11/10/88
removed from the Nationa other, (explain:)	ai Hegister.			Signature of the	no Kooper		Date of Action

6. Function or Use		S-408
Historic Functions (enter categories from instructions) Domestic/şingle dwelling		ctions (enter categories from instructions) c/single dwelling
Domestic/secondary structure	Domesti	c/secondary structure
Agriculture /processing		ture/processing
7. Description		
Architectural Classification (enter categories from instructions)	Materials (er	nter categories from instructions)
	foundation_	Brick
Federal	walls	Weatherboard
	roof	Asphalt
	other	Wood

Describe present and historic physical appearance.

DESCRIPTION SUMMARY:

Catalpa Farm is located one mile south of Princess Anne, Somerset County, Maryland on the east side of the old Princess Anne-Westover Road. A long farm lane intersects the Princess Anne-Westover Road and leads to the farmhouse and a significant group of outbuildings. The farmhouse faces west with the principal gable oriented on a north/south axis. The house is a two-story, five-bay center passage structure built in two principal stages, beginning with a two-story, threebay side-hall parlor house with service wing erected around 1825-1840. A twostory one-room plan frame addition was attached shortly thereafter to the north gable end of the front block. A two-story one-room plan kitchen was originally joined to the main block by a single-story hyphen, the present dining room, which was later raised to a two-story height. More recent shed roofed additions have been attached to the south and east sides of the service wing. Supported by a minimal brick foundation, the two-story house is largely covered by beaded weather-The second floor level of the hyphen, added later, is the most conspicuous section not sheathed with the beaded siding. A layer of asphalt shingles covers the medium sloped gable roof. The west or main elevation is an asymmetrical facade with a centrally located front door and flanking nine-over-six sash windows on the first floor. Five unevenly spaced six-over-six sash windows light the second floor. The outbuildings that accompany the house include an early nineteenthcentury dairy and smoke house of the same period, a late nineteenth-century privy, a modern garage, a mid nineteenth-century corn crib, an early twentieth-century gambrel roofed barn, and an early nineteenth-century tobacco house.

United States Department of the InteriorNational Park Service

National Register of Historic Places Continuation Sheet

Section number _	7	Page1	Catalpa Farm	S-408
		1 ago	Somerset County, Maryland	

GENERAL DESCRIPTION:

Catalpa Farm is located one mile south of Princess Anne, Somerset County, Maryland on the east side of the old Princess Anne-Westover Road. A long farm lane intersects the Princess Anne-Westover Road and leads to the farmhouse and a significant group of outbuildings. The farmhouse faces west with the principal gable oriented on a north/south axis.

The house is a two-story, five-bay center passage structure built in two principal stages, beginning with a two-story, three-bay side-hall parlor house with service wing erected around 1825-1840. A two-story one-room plan frame addition was attached shortly thereafter to the north gable end of the front block. A two-story one-room plan kitchen was originally joined to the main block by a single-story hyphen, the present dining room, which was later raised to a two-story height. More recent shed roofed additions have been attached to the south and east sides of the service wing. Supported by a minimal brick foundation, the two-story house is largely covered by beaded weatherboards. The second floor level of the hyphen, added later, is the most conspicuous section not sheathed with the beaded siding. A layer of asphalt shingles covers the medium sloped gable roof.

The west or main elevation is an asymmetrical facade with a centrally located front door and flanking nine-over-six sash windows on the first floor. Five unevenly spaced six-over-six sash windows light the second floor. Separating the third and fourth bay from the south is a vertical seam in the weatherboarding. The flush panel front door is flanked by three-over-two sidelights and three-light transom. Protecting the entrance bay is a classical Tuscan columned portico with a simple pedimented front. Flanking each window is a pair of louvered shutters held back by twisted iron shutter dogs. A boxed cornice with bed molding finishes the base of the roof; however, in later years, the eaves were extended with short returns at the base of the roof.

The north and south gable ends of the main block are essentially the same with an exterior, single-shouldered, seven-course common bond brick chimney centered between two nine-over-six sash in the first floor and two six-over-six sash on the second. The attic is lighted by a pair of two-over-two sash windows.

The east (rear) elevation of the main house is partially covered by the twostory dining-room service wing and its shed additions. An interior brick stove stack rises from the central portion of the service wing, while a large doubleshouldered brick chimney rises against the east wall of the kitchen. Window and door details remain basically unchanged from the front of the house.

The early nineteenth-century interior of the house has not been altered significantly. The center passage retains its period stair which rises against the south wall of the passage beginning with several winder steps. The square

OMB Approval No. 1024-0018

NPS Form 10-900-a

United States Department of the InteriorNational Park Service

National Register of Historic Places Continuation Sheet

Section number	7	Page .	2	Catalpa Farm Somerset County, Maryland	S-408
				Joiner Set Country, mary rand	

newel post and square balusters support a circular-profile handrail. The stringer is decorated with scrolled trim. A four-panel door opens into the stair closet. Flush six-panel doors framed by thumb mold backband surrounds open into the adjacent dining room, parlor and living room. The north room, probably used as a formal parlor, is finished in a more elaborate manner than the other rooms with a Federal style mantel, molded chair rail, and a decorative plaster cornice. The mantel has fluted pilasters which support a five-part frieze. The end blocks are fluted while the center tablet was left plain. The mantel shelf is decorated with a reeded bed molding. The shelf is stepped and broken at each end. Carpenter box locks still remain on many of the doors.

The south room is finished in a less elaborate manner. The Federal mantel has reeded pilasters and reeded frieze end blocks; the center tablet is plain. Similar to the mantel in the parlor is the molded and broken shelf. The room is fitted with the same early nineteenth-century chair rail and baseboard, but the room does not have a molded plaster cornice.

The second floor is divided into four rooms with the same wide center passage. The south room has an early nineteenth-century mantel with a molded surround, a plain frieze and a molded mantel shelf. The doors and windows are framed in this room by cyma curve surrounds. The north end of the second floor is divided into three small rooms. The hall door enters into a small hall-like space that provides access to the north bedroom and another small bedroom or storage room. The smallest room, now used for storage, has a six-panel door topped by a three-light interior transom. These two spaces were never directly heated. The north bedroom, on the other hand, has a Federal style mantel with a molded surround that supports a five-part frieze with three undecorated blocks. The mantel shelf is correspondingly molded and broken at each end.

The attic of the main house is reached through a four-panel door that opens from the second floor of the hyphen. The attic space is divided into two rooms. The north room is plastered, while the space above the initial house has an exposed common rafter roof held together with wood pins and mature cut nails.

The rear dining room/kitchen wing has been remodeled to some degree, but many of the original features were left undistrubed. An enclosed stair rises from the dining room to the second floor bedroom above the kitchen. The first floor kitchen interior has been enlarged with the removal of the south wall; however, the original dimensions of the six-foot cooking hearth were retained. The second floor of the kitchen is divided into a bedroom and bathroom, while the second floor of the hyphen is one large room. An enclosed ladder stair rises to the kitchen attic, which is plastered. A small window opening in the west wall of the kitchen attic (now covered over by the raised hyphen) permits access into the hyphen attic. Visible on the rear wall of the main house and the west wall of the kitchen are the flashing lines of the former hyphen roof. The shed additions that surround the kitchen were apparently added around the turn of the century.

United States Department of the Interior National Park Service

National Register of Historic Places Continuation Sheet

The outbuildings that accompany the house include an early nineteenth-century dairy and smoke house of the same period, a late nineteenth-century privy, a modern garage, a mid ninteenth-century corn crib, an early twentieth-century gambrel roofed barn, and an early ninetenth-century tobacco house. Standing nearest the house on the north side is the single-story frame dairy that dates to the same period as the house, c. 1835-1840. The one-room, weatherboarded frame structure was enlarged on the south side with a shed addition that houses the pump. The structure is supported by a minimal brick pier foundation, and is covered with a mixture of plain lapped weatherboards, flush weatherboarding, and German siding. The steeply pitched roof is covered with asphalt shingles. The front (west) elevation is marked by a centered six-panel door. A six-pane window lights the adjacent pump house shed. The north side of the dairy is pierced by a simple four-pane window, while the east (rear) elevation has two four-pane windows, one lighting each floor. A narrow brick stove stack has been added to the east end. The south side of the dairy is fully covered by the shed addition. The dairy interior has remained largely intact with plastered wall surfaces and bracketed shelving. Riven lath held with cut-nails is exposed in a few sections. A layer of old blue paint remains on sections of the shelving. The loft space is entered through a small access hole in the northwest corner, where a common rafter roof is clearly visible.

Located directly north of the dairy is the contemporary frame smoke house which rests on a minimal brick foundation and has been resheathed with new weather-boards. The steeply pitched roof is covered with asphalt tile shingles. The west (main) facade is marked by a single board door with round-tipped iron strap hinges. The interior has a brick paved floor and fully blackened walls and ceiling. The studs are set on one-foot centers.

Standing behind the smoke house is a frame privy sheathed with German siding and covered by a medium sloped wood shingle roof. The front (west) wall has a diagonal board door, and the north side has a louvered opening. The clean-out is located at the bottom of the east side. Inside, the privy has three seats, and exposed framing members have been whitewashed.

The c. 1850-1875 corn crib stands south of the house between the modern garage and the gambrel roofed barn. Supported by a clay-pot pier foundation, the corn crib is sheathed with narrow vertical slats, and the rectangular structure is covered by a steeply pitched asphalt shingle roof. Two doors are located on the west side to provide access into the divided interior. Some of the framing members of the corn crib including the corner posts, plates, joists, and rafters were reused from an earlier structure.

The gambrel roofed barn, built around 1910, was assembled on a minimal brick foundation and sheathed with narrow weatherboard siding. The gambrel roof is covered with asphalt shingles. The west (main) elevation is distinguished by a center passage entrance as well as several other smaller doors. Located in the

United States Department of the interiorNational Park Service

National Register of Historic Places Continuation Sheet

Section number7	_ Page	Catapla Farm Somerset County, Maryland	S -4 08
Goddon Hambor	ugc	Somerset County, Maryland	

upper gable is a hay loft door and hay rack. The south side of the barn is covered by a shed roofed implement shed, while the north side is marked by four-pane windows. The east end has a center passage sliding door as well as a small window in the upper gable. The interior is divided into animal stalls which flank a wide center passage. The upper floor, on the other hand, is one large cavernous space used for hay storage. A complex rafter system of multiple rafter layers relieves any need to obstruct the interior space with roof framing.


Finally, the tobacco house is located at the south end of the farmyard. The single-story gable front frame structure is supported by a minimal brick foundation, and it is sheathed with a combination of weatherboards and German siding. The squarish frame center structure is covered by a steeply pitched gable roof, while the side sheds are covered by a less steep shed roof; all of which is covered with asphalt shingles. The west (main) elevation is marked by a central board door and another door that opens into the south shed. The interior is divided into three sections with a center room and flanking sheds. The pit-sawn lumber is held together by a combination of mortise-and-tenon joints for the principal posts and mature cut-nails for the studs. Two tiers of collars rise above the tie beams. Corresponding rails are nailed into the interior face of the front and rear gables where tobacco sticks were supported. The rafter peaks have pinned mortise-and-tenon joints. An odd feature of the roof frame is a pair of lateral, diagonally placed beams that stretch downward from the center of the roof to the front and rear girts.

United States Department of the Interior National Park Service

National Register of Historic Places Continuation Sheet

Section number _____7 Page ____5 Catalpa Farm Somerset County, Maryland

S-408

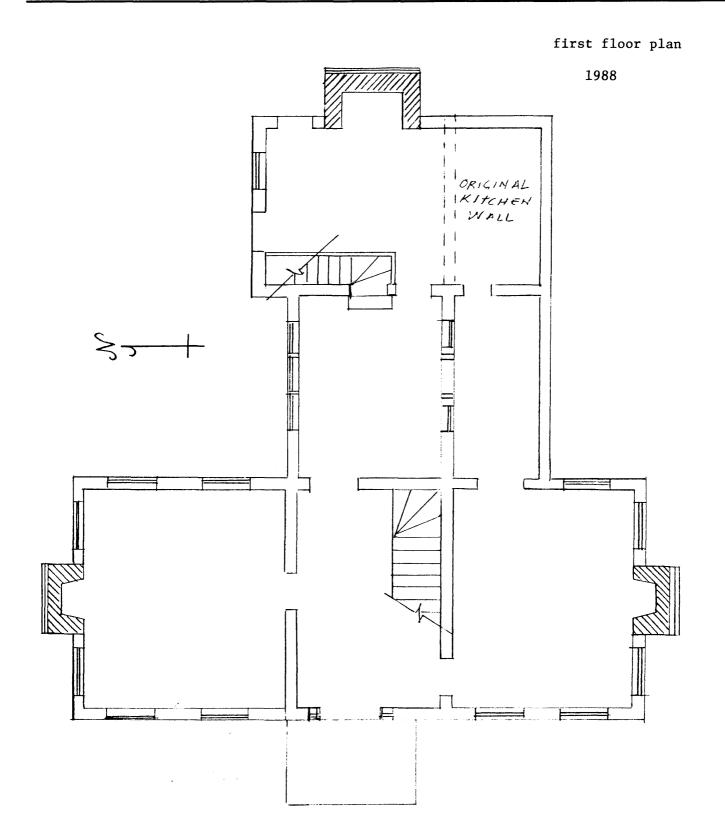

9 Statement of Significance		
8. Statement of Significance Certifying official has considered the significance of this property	v in relation to other properties:	S-408
	tatewide X locally	
Applicable National Register Criteria A B XC	D	
Criteria Considerations (Exceptions)	D DE F G	
Areas of Significance (enter categories from instructions) Architecture	Period of Significance 1825-1875	Significant Dates
	Cultural Affiliation N/A	
Significant Person N/A	Architect/Builder unknown	

State significance of property, and justify criteria, criteria considerations, and areas and periods of significance noted above.

SIGNIFICANCE SUMMARY:

Caltalpa Farm is significant in Somerset County for the architectural character of the domestic and agricultural buildings standing on the property. The two-story, early nineteenth-century farmhouse reflects the strong vernacular traditions of the area established during the eighteenth and nineteenth centuries. The two-story center hall passage farmhouse with a hyphenated service wing was developed in stages, beginning around 1825-1840 with a two-story side passage/parlor dwelling. Attached to the back of the main block was a single-story hyphen or colonade which joined the two-story kitchen. The resulting stepped profile of the house was a common feature of regional southern Maryland architecture until the early twentieth century. Shortly after initial construction, a second building program included the addition of a two-story one-room plan wing that resulted in the traditional center passage, single-pile house. The exterior finishes have remained well preserved with most of the beaded weatherboarding, windows, shutters, and shutter dogs intact. Likewise, the interior survives with large percentages of the late Federal mantels, doors, chair rail, stairs, and cornice intact. Catalpa farm also contains an unusual number of agricultural or domestic outbuildings that have not commonly survived on other farms. The most significant outbuilding is the tobacco house, probably built during the second quarter of the nineteenth century. tobacco house is one of five known to survive on the Eastern Shore and represents the last generation of tobacco houses erected on the lower Eastern Shore before the growth of tobacco was suspended. In contrast to the other three tobacco houses, the Catalpa farm example is smaller and was built with a broken roofline. The working elements of the interior spaces are basically the same. The dairy is also a relatively infrequent survival, especially with its shelving and plastered interior. The smoke house, privy, corn crib, and gambrel roofed barn are more typical survivals from their various periods.

9. Major Bibliographical References	S-408
Land Records of Somerset County, MD, Somerse Princess Anne, MD.	et County Courthouse, various volumes,
1798 Federal Direct Tas Assessment, Microfil	m, Somerset County Library.
Register of Wills, Somerset County Courthous	e, various volumes, Princess Anne. MD.
Maryland Inventory of Historic Properties, M	
	See continuation sheet
Previous documentation on file (NPS): preliminary determination of individual listing (36 CFR 67)	Primary location of additional data:
has been requested	X State historic preservation office
previously listed in the National Register	Other State agency
previously determined eligible by the National Register	Federal agency
designated a National Historic Landmark	Local government
recorded by Historic American Buildings	University
Survey # recorded by Historic American Engineering	X Other Specify repository:
Record #	Somerset Co. Historical Trust
	Princess Anne, MD
0. Geographical Data	
Acreage of property 5.94 acres	
JSGS quad: Princess Anne, MD	
JTM References A [1 8 [4 4 0 5 0 0] [4 2 2 6 4 6 0]	
A [1]8] [4]4]0[5]0]0] [4]2[2]6[4]6]0] Zone Easting Northing	Zone Easting Northing
	See continuation sheet
/erbal Boundary Description	
The boundaries are delineated on the boundar Continuation Sheet 10/1.	ies and resource sketch map on
	X See continuation sheet
Boundary Justification The 5.94 acres included in th	is nomination comprise the immediate
area around the Catalpa farm buildings. The	boundary line is arbitrary but does
fallow the apparent proporty line established	in 1973 when the house and outbuildings

were divided from the surrounding farmland which does not contribute to the significance of the site.

See continuation sheet

11. Form Prepa	red By					
name/title	Paul B. Touart,	Architectural Historian				
organization	Somerset County	Historical Trust	_ date	10/9/87		
	P. O. Box 5		_ telephone	(301)651-	-1094	
city or town	Westover		state Ma		zip code	21871

United States Department of the Interior National Park Service

National Register of Historic Places Continuation Sheet

Section number8 Page1	Catalpa Farm Somerset County, Maryland	S-408
-----------------------	---	-------

HISTORIC CONTEXT:

MARYLAND COMPREHENSIVE HISTORIC PRESERVATION PLAN DATA

Geographical Organization: Eastern Shore

Chronological/Developmental Period(s):
Agricultural-Industrial Transition A.D. 1815-1870

Prehistoric/Historic Period Theme(s):
Architecture/Landscape Architecture/Community Planning

Resource Type:

Category: buildings

Historic Environment: rural

Historic Function(s) and Use(s):
 single dwelling
 domestic/secondary structure
 agriculture/processing

Known Design Source: unknown

Catalpa farm has had its longest historical associations with the Long family, beginning with Zadock Long, who purchased several tracts of land, "Law's Purchase," "Davis's Choice," and "Walton's Improvement" from John and Margaret Byrd and Mary Smith in 1804 (P/392). Prior to Long's ownership, the plantation was apparently tenanted by Joseph Matthews, whose name is listed on the 1798 tax assessment as occupying the land of John Bird. The description of the house reads,

1 Dwelling House 34 by 16 feet, wood one story with 3 windows 4 feet 10 inches long, 2 feet 4 inches wide, 3 windows 3 feet 8 inches long, 2 feet 4 inches wide and in midling repair, 1 cook house 20 by 16 feet.

Also on the property was another dwelling occupied by Peggy Politte, which was described as,

1 Dwelling House 30 by 18 feet wood, one story high, 4 windows 4 feet 10 inches long, 2 feet 4 inches wide with addition of 15 by 10 feet with 1 window 3 feet 8 inches long, 2 feet four inches wide, 1 Cook house 16 by 15 feet, 1 Laundry house 16 feet, 1 stable 20 by 10 feet, 1 Necessary house, 8 feet square, all in good repair.

United States Department of the interior National Park Service

National Register of Historic Places Continuation Sheet

ection number8 Page2	Catalpa Farm Somerset County, Maryland	S-408
----------------------	---	-------

However, neither of these descriptions fits the present dwelling on the property. Due to the late Federal design of the exterior and interior woodwork as well as the use of mature cut-nails throughout the house and outbuildings, it is thought the earliest extant structures were erected during the ownership of Zadock Long, which stretches from his purchase in September of 1808 to his death in February of 1838.

Zadock Long's will, proved on February 13, 1838, stipulated that the "land purchased of John Byrd and wife and Mary Smith and the mill lot adjoining" would pass to Edward H. C. Long (JP 5/17). Edward Long occupied the farm until 1865, and at his death the "home farm and mill lot" passed to Charles Whittington Long, who held on to the property for fifty years. Charles W. Long sold the 335-acre farm, then known as "Catalpa Farm" to E. Walter Long in 1915 (JMT 106/525). After E. Walter Long's death in 1971, the property passed to his personal representatives, Virginia L. Long and John W. Long (276/748). In 1974, Robert W. and Lois Long sold 5.94 acres surrounding the house and outbuildings to Donald L. and Elizabeth M. Henderson (280/237). In 1984, the house was sold once more to Dr. Raymond Zeigler.

The other tobacco houses, different and earlier than tobacco barns, stand at Clays Hope in Talbot County (T-189), Daniel Ballard Farm (S-161), Thomas Sudler Farm (S-173), and Sutler's Conclusion (S-56) in Somerset County. This group, including the one on Catalpa Farm have been professionally and scientifically studied and are the only known examples to exist.

The Catalpa Farm has a high potential for the presence of important archeological resources associated with its historic occupation and use. Archeological investigations may assist in documenting dates of construction and alterations of the main house and outbuildings. In addition, testing may provide information concerning the farm's spatial organization and the social/cultural/economic patterns of its inhabitants.

The 5.94 acre parcel has a low potential for containing prehistoric archeological resources, due to its environmental location.

United States Department of the interior National Park Service

National Register of Historic Places Continuation Sheet

Section number ______ Page ____ Catalpa Farm Somerset County, Maryland

S-408

boundaries and resource sketch map, 1988

