PARK/AREA NAME: Glacier National Park REGION: Rocky Mountain PARK NUMBER: 1430 STRUCTURE NAME: Kishenehn Ranger Station Cabin STRUCTURE NUMBER: 105 LOCATION OF STRUCTURE: Sec. 23, T37N R22W QUADRANGLE NAME: Trail Creek, MT Zone Easting Northing QUADRANGLE SCALE: 7.5-minute UTM A: 11 688940 5426100 CLASSIFICATION: NUMBER OF RESOURCES: OWNERSHIP OF PROPERTY: CATEGORY: CONTRIBUTING NONCONTRIBUTING Private x Building(s) Buildings \_x\_ District Public-Local Sites \_\_\_ Site Public-State Structures x Public-Federal Structure Objects Mixed/private & public Object TOTAL

#### ARCHITECTURAL DESCRIPTION AND EVALUATION:

This cabin is used for patrol purposes and faces west. The cabin is a single-story, three-room structure with front and rear covered porches. The log-on-log walls have squared inside and corner portions, bard on the exterior, log purlins, and a wood-shingled gable roof. The extended porch's gable end features a "fan" configuration of pole braces between the colar beam and purlin ends. The cabin has tongue-and-groove planking on interior walls, a brick chimney, and cement chinking. The floor plan includes a living room, kitchen, and bedroom. The living room floor is weak and sagging in places. The Kishenehn Ranger Station is a substantial and unique log building that dates to the years before the widespread use of standardized Park Service building plans. The two end wall porches, one an extension of the gable roof with decorative fan bracing and the other a simple shed, give the ranger station the appearance of a private cabin. It is the other structures at the site that indicate that this is a park management site. The building is architecturally significant and is a contributing element of a potential historic district.

#### HISTORICAL DEVELOPMENT AND EVALUATION:

DATE OF CONSTRUCTION: 1921

In 1919, a fire destroyed the original Kishenehn ranger station built in 1913, but because of its strategic location near the Canadian border, the station was rebuilt within two years. By 1931, the North Fork Road was extended to the station as part of a plan to complete a loop road around the park boundaries. Today, a collapsed bridge south of the station and decades of no road maintenance leave the site accessible only by trail past the Kintla Lake turnoff. As one of the first ranger headquarters, Kishenehn's location 3 miles south of the Canadian/United States border and near the confluence of Kishenehn Creek and the North Fork River was extremely important in guarding against game poachers and trappers in the populated North Fork Valley. The early (ca. 1912) jurisdiction of this station extended from "halfway between Waterton Lakes and Kishenehn to Indian Creek" (also known as Akokala Creek).

STRUCTURE NAME: Kishenehn Ranger Station Cabin STRUCTURE NUMBER: 105

#### STATEMENT OF SIGNIFICANCE:

The ranger station/residence is a significant and contributing component of the proposed Kishenehn Ranger Station Historic District. The buildings at the site -- ranger cabin, fire cache, barn, and woodshed -- combine in a traditional ranger station complex. Like the Belly River ranger station on the east side of the Continental Divide, Kishenehn is accessible only by trail. However, Kishenehn serves seasonally in the management function of a patrol cabin for the Upper North Fork and has not been manned as an administrative site for many years. The history of the Kishenehn ranger station illustrates the factors that influenced the locations of early administrative/management sites and how changes in Park use and development have affected individual stations. The Kishenehn Ranger Station Historic District is eligible for listing on the National Register of Historic Places under criteria a and c.

#### **BIBLIOGRAPHIC REFERENCE:**

<sup>1</sup>Superintendent's Annual Report, 1921, Glacier National Park, p. 14.

<sup>2</sup>Superintendent's Annual Report, 1931, Album #3, Glacier National Park, p. 59.

<sup>3</sup>Superintendent's Annual Report, 1913, Glacier National Park.

FORM PREPARED BY: DATE: June 1984

NAME/TITLE:

ORGANIZATION: Historical Research Associates, P.O. Box 7086, Missoula, MT 59807-7086

REGION:	Rocky Mounta	in PARK/AR	REA NAME:	Glacier	National	Park	PARK !	NUMBER:	1430
STRUCTUR	E NAME: Barn					ST	RUCTURE	NUMBER:	363
	Zone Easting		_	ioņ	•		AME: Tra		·
UTM A:	11 688940	5426100							
Pro	CATION: HIP OF PROPER rivate ublic-Local ublic-State ublic-Federal ixed/private		ORY: Building( District Site Structure Object	s)	NUMBE NTRIBUTING 1   1		SOURCES: ONTRIBUT:	ING Build Sites Struc Objec TOTAL	tures ts
ARCHITECT	TURAL DESCRIP	TION AND EVALUA	TION:						
structure enclose grooved structure concret splitti station constructure similar Ranger ful con The but	ure is of typed tack room dundersides ure has pole te foundation ing logs. The paracted according buildings estation barn mbination of	ccasionally use ical Park barn (on ground leve of logs. The lafters, a wood. The condition is large, log, k, including Uping to standardixist within oth in Yellowstone rustic architechitecturally si	construct 1). The og crowns -shingled n of the horse bar per Lake zed plans er wester ture with	ion, with log walls are batt roof, do structure n is simi McDonald designed n nationa equent us the fund	n an uppers have reviewed with ouble dutoe is fair illar to the and Walted by the last parks, se of this ctional records.	r loft, verse s h rusti ch door , with hose loo on. Th Landsca such a s desig	two standaddle not cated end cated at ese barns pe Archites the Snan suggestents of a	lls, and tching a ds. The ests on ole rot other res were tect. Oake Rive ts a suca horse	nd a and anger ther, r cess- barn.
HISTORICA	AL DEVELOPMEN	Γ AND EVALUATIO	N:	DATE	OF CONST	RUCTION	: 1934		
		elded any signi ith this buildi		storical	informat	ion con	cerning p	persons	or
STATEMENT	r of signific	ANCE:							
		ecturally signi ation Historic			ontributi	ng elem	ent of th	ne propo	sed
BIBLIOGRA	APHIC REFEREN	CE:							
FORM PREI	PARED BY:						DATE: Ji	une 1984	


ORGANIZATION: Historical Research Associates, P.O. Box 7086, Missoula, MT 59807-7086

NAME/TITLE:

REGION:	Rocky Mountai	n PARI	K/AREA NAME	: Glacier	National	Park	PARK	NUMBER:	1430
STRUCTURE	NAME: Woods	hed				STR	UCTURE	NUMBER:	364
LOCATION	OF STRUCTURE:			ation	QUADRA	ANGLE NA	ME: Tr	ail Cree	k, MT
	Zone Easting 11 688940	Northing	District		QUA	DRANGLE S	SCALE:	7.5-min	ute
CLASSIFICA	ATION:				NUMBE	R OF RES	OURCES:		
OWNERSH	IP OF PROPERT	Y: CAT	TEGORY:	CO	NTRIBUTING	G NONCO	NTRIBUT	ING	
Pri	ivate		x Buildin	g(s)	1			Build	ings
Pul	blic-Local	-	x Distric	t	<del></del>		<del></del>	Sites	_
Pul	blic-State	-	Site					Struc	tures
x Pul	blic-Federal	_	 Structu	re				Objec	ts
Miz	xed/private &	public	Object		1		<del></del>	TOTAL	
ARCHITECTU	URAL DESCRIPT	ION AND EVA	ALUATION:						
a pole of foundation No range Some stagas, but typical contribution	hiplap interior floor, six-light ion. The concert station contactions use work back-country, exterior logutes to the a	ght casemendition of tomplex in Glood as a backy stations g frame controllectura	nts in the the woodshe lacier is wock-up heat still dependent of the struction al signific	gable ends d is fair, ithout a s source, re nd upon wo with flush ance of th	, and rest but extended hed for dealying print od for the interior e site.	ts on a point of the control of the	poured of ters are ed stora electron electron alls.	concrete e rottin age of w ctricity It is o	g. ood. or f
HISTORICAL	L DEVELOPMENT	AND EVALUA	ATION:	DATE	OF CONSTI	RUCTION:	1935		
CCC buil	dshed was con lt this and t s, all on the	hree identi	ical woodsh	eds at Pol	ebridge, I	Logging,	and Ķi		
STATEMENT	OF SIGNIFICA	NCE:							
	ominent featu tributes to t								grity
BIBLIOGRAI	PHIC REFERENCE	E:							
l"Buildi	ings Built by	CCC Since	1935 to De	cember 193	7," File:	620, G	eneral,	CCC, GN	PLA.
							4 mm	1007	
FORM PREPA						DA	ATE: J	une 1984	
	E/TITLE:				_	26 251	•		7001
ORGAN	IZATION: His	torical Res	search Asso	ciates, P.	O. Box 708	36, Misso	oula, M	r 59807	-7086

REGION: Rocky Mountain PARK/AREA NAME: Glacier National Park PARK NUMBER: 1430 STRUCTURE NAME: Fire Cache STRUCTURE NUMBER: 368 LOCATION OF STRUCTURE: Kishenehn Ranger Station QUADRANGLE NAME: Trail Creek, MT Historic District Zone Easting Northing QUADRANGLE SCALE: 7.5-minute UTM A: 11 688940 5426100 CLASSIFICATION: NUMBER OF RESOURCES: OWNERSHIP OF PROPERTY: CATEGORY: CONTRIBUTING NONCONTRIBUTING Private x Building(s) 1 Buildings Public-Local \_x\_ District Sites \_\_\_\_Site Public-State Structures x Public-Federal Structure Objects 0 Mixed/private & public Object TOTAL ARCHITECTURAL DESCRIPTION AND EVALUATION: The structure, which faces west, contains a few stored tools and a workbench, but is not used much. The fire cache is a single-story, one-room building with regularly saddlenotched log walls and full sapling chinking. Rafter poles run longitudinally along the wood-shingled roof. The floor is 1" planking and the structure rests on a poured concrete block foundation. The condition of the structure is poor, with much rot in wall and rafter logs. The fire cache, which stores fire-fighting equipment and other maintenance tools, is a pivotal element of most ranger stations in Glacier. This log fire cache is similar in scale and design to those located at the Upper Lake McDonald, Belly River, and Kintla Lake ranger stations. The building is architecturally significant and is a contributing element of the site. HISTORICAL DEVELOPMENT AND EVALUATION: DATE OF CONSTRUCTION: 1934 Research has not yielded any significant historical information concerning persons or events associated with this building. STATEMENT OF SIGNIFICANCE: Despite its poor condition, the Kishenehn fire cache is significant in the architectural history of Glacier National Park. It is a contributing element of the Kishenehn Ranger Station Historic District. BIBLIOGRAPHIC REFERENCE: DATE: June 1984 FORM PREPARED BY: NAME/TITLE:

ORGANIZATION: Historical Research Associates, P.O. Box 7086, Missoula, MT 59807-7086

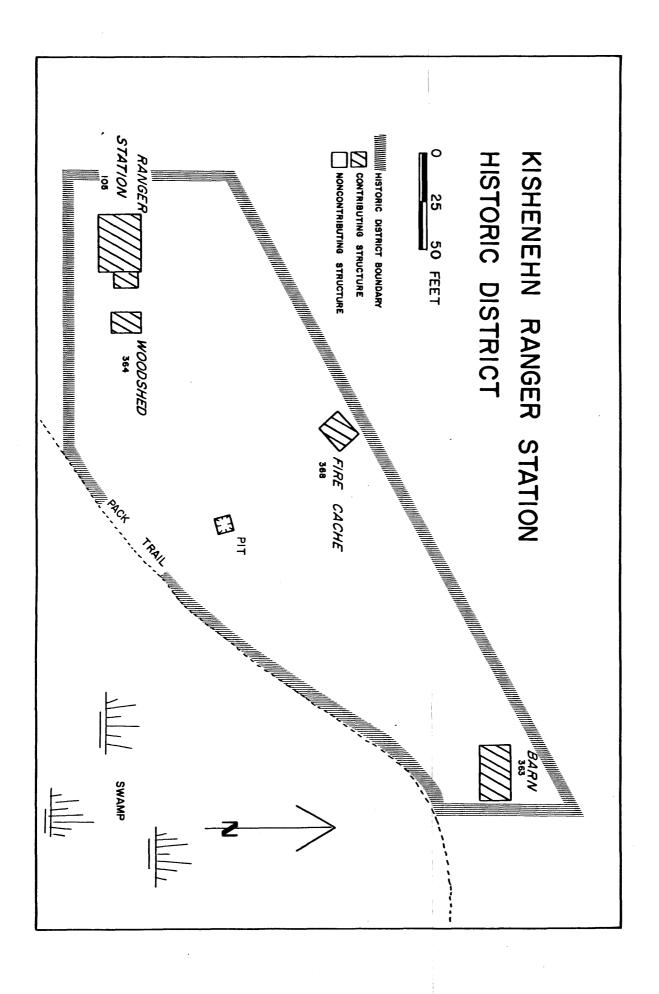

8600335 T

#### United States Department of the Interior National Park Service

## **National Register of Historic Places Continuation Sheet**

Kishenehn Ranger Station Historic District (addendum), Flathead County, MT.

3. State/Federal Agency Certification						
As the designated authority under the National Historic Preserve meets the documentation standards for registering properties in Part 60. In my opinion, the property X meets does not m statewide _X locally. ( See continuation sheet for addition	the Nation eet the Na	al Register of Historic Places and meet tional Register Criteria. I recommend t	s the procedural and professional requirements set forth in 36			
Signature of certifying official/Title			12.5.95 Date			
National Park Service State or Federal agency or bureau						
Signature of commenting or other official  Montana State Historic Preservation Office State or Federal agency and bureau  4. National Park Service Certification	the results	al Register criteria.	SEP 2 9 1995. Date			
I, hereby certify that this property is:  entered in the National Register  see continuation sheet	fr	Signature of the Keeper	Date of Action			
determined eligible for the National Register						
determined not eligible for the National Register						
removed from the National Register						
other (explain) additional documentation	Bu	ym. Lapsley	1/19/96			

Additional Documentation Accepted

## United States Department of the Interior National Park Service

# National Register of Historic Places Continuation Sheet

Section number

7

Page 2

Kishenehn Ranger Station Historic District (addendum), Flathead County, MT.

### **Building Interiors**

The following buildings are listed in the National Register of Historic Places as contributors to the Kishenehn Ranger Station Historic District. Additional documentation is provided below for the purpose of describing and evaluating building interiors for integrity and significance.

#### 7. Narrative Description

#### Ranger Station (#105), 1921

The interior of this cabin is divided into two rooms: a front living/sleeping area and a back kitchen. A non-bearing frame wall, sided on the living room side with vertical shiplap and unfinished on the kitchen side, divides the space. (It is not known when this wall was constructed. Circa 1950 maintenance records describe this as a three-room building, with a kitchen, bedroom, and living room. The interior room configuration and interior walls may be an alteration. The current materials suggest, however, that the maintenance record is erroneous and that the current configuration is historic if not original.)

The single interior door is five panel, with a wood handle. The front entry, also five-panel has a metal handle/lockbox and the rear door has a black porcelain handle. Baseboard is generally 4" painted, as are door and window surrounds; the baseboard has been removed along all but the north wall of the kitchen. As during the historic period, the east, north, and west walls are sided with horizontal 6" shiplap planks, painted white. The south wall, in the front room, is similarly sided; the southeast corner of the kitchen, however, is sided with celotex (wallboard) and plywood covers the remainder of the south wall. As during the historic period, celotex panels cover the low (7') dropped ceiling. A square of celotex in the southeast corner of the front room ceiling has been cut away from the main ceiling and is secured with duct tape. This "door" provides access to the attic space.

Carpet covers the original 4" fir floors in the living room and extremely thick and hard rolled linoleum (tile board?) and carpet cover kitchen floors. (The carpeting appears to be laid over 1" plywood sheeting, suggesting extensive deterioration of the original floors.) Kitchen features include an elaborate wood burning cook stove (adjacent to a brick chimney), a paneled wood cabinet with original decorative metal hinges and turn latch, wall mounted open shelving units, and an NPS-standard cupboard unit with bottom hinged door/drop table. A white enameled sink, set in a wood counter, is located along the east wall of the kitchen. In June of 1993, the drain was disconnected from the elbow connection, allowing the sink to drain into a metal bucket. A trap door in the kitchen leads to a concrete lined/wood floor root cellar. Canned goods fill the open shelving system.

The front room contains a wood burning stove (with a metal hearth and Z-brick wall mount) and two metal-frame beds. Metal hooks/ceiling shields are suspended from every corner for Coleman lanterns. A 1933 photo of the "Thanksgiving Crew" - identified as Joe Heimes, Ben Miller, Elmer Fladmark, Channing Howell, Ray Newberry, Andy Fleutsch, Hugh Buchanan, and Hugh Peyton, hangs on the wall.

## United States Department of the Interior National Park Service

# National Register of Historic Places Continuation Sheet

Section number

7

Page 3

Kishenehn Ranger Station Historic District (addendum), Flathead County, MT.

#### Barn (#363), 1934

The barn, restored in July of 1992, features a central space with two stalls/feed troughs and a feed room in the northwest corner, and a hay loft. Within the central space, floors are dirt, walls are log, and a double layer of 7" pine shiplap planks, laid over log joists, form the dropped ceiling (and the loft floor). Feed troughs are constructed of a pole frame, infilled with 12" vertical planks.

The feed room floor is concrete. The ceiling and all but the north wall are finished with 6" shiplap (or tongue-and-groove) planks; the north wall is sided with 12" planks.

A unique pole ladder provides interior access to the loft storage space. Doors, including the primary double dutch doors, are constructed of 5"-6" horizontal planks, secured on both sides of a wood frame, and feature long hinges and slip latches.

#### Woodshed (#364), 1935

This simple one-room utilitarian building is constructed with an exposed pole framing system, infilled with board-and-batten siding. This same framing system and siding forms the interior walls. Two-inch by four-inch milled lumber, laid on the diagonal, provides additional interior structural support; these may represent modifications. Poles form the floor. The ceiling is open to the roof, exposing the frame truss system. The door is constructed of horizontal 6" wood planks and features a pounded heavy-wire handle.

#### Fire Cache (#368), 1935

This small one-room log building is finished with 5" pine floors and log interior walls with sapling chinking. The six-light fixed-sash windows located in the north and south walls are set in the log walls (without surrounds). The ceiling is open, exposing the log truss system. (Narrow poles spanning the purlins may be an alteration.)

#### Pit Toilets (#366, #367)<sup>1</sup>

Toilet #367, reported to have been constructed in 1922, could not be located. The site is littered with burn-and-fill scars, however, suggesting that the toilet was frequently moved. Pit toilet #366 is a surprisingly substantial unpeeled-log building with chopper cut log ends and an extended front gable roof reminiscent of those found on backcountry patrol cabins. The building's simple notching, excellent physical condition, and unique cabin-parody design suggest that it is a relatively recent addition to the historic district. The toilet itself is modern, described by survey crews as a "standard backcountry commode, aluminum stand with lid and plenty of mosquitos." The building is shown on the original site map.

These prosaic resources were not evaluated in the 1984 nomination/multiple property submission. HRA was asked to photograph these buildings and to place them on the site maps (see photographs). The outhouses have not been evaluated.

# **United States Department of the Interior**National Park Service

# **National Register of Historic Places Continuation Sheet**

Section number

8, Photographs

Page 4

Kishenehn Ranger Station Historic District (addendum), Flathead County, MT.

#### 8. Statement of Significance

Although modified, the ranger station (#105) retains sufficient historic resources to present an historic appearance and to contribute to the building's significance. (Noncontributing interior finishes are those described as modern, above.) The fixed furnishings, representative of those found in backcountry cabins throughout the park, are of special significance.

All other interiors appear to be unmodified and contribute to the buildings' significance.

#### **Photographs**

1) Photographer:

Jason Wilmot

2) Date of Photographs:

June 1993

3) Location of Negatives:

National Park Service, RMR-RC, Denver, CO.

PHOTO NUMBER	STRUCTURE NAME AND NUMBER	LOCATION/DIRECTION OF VIEW		
1	Ranger Station Cabin (#105)	Wood stove in front room (note coleman-lantern wall shield)		
2	Ranger Station Cabin (#105)	Interior of front door		
3	Barn (#363)	Interior - ladder to loft		
4	Barn (#363)	Interior - feed trough		
5	Barn (#363)	Interior - feed/tack room		
6	Woodshed (#364)	Interior		
7	Woodshed (#364)	Interior		
8	Pit Toilet (#366)	View to Northeast		
9	Pit Toilet (#366)	View to Southwest		
10	Pit Toilet (#366)	Interior		
11	Fire Cache (#368)	Interior - detail of truss system		
12	Fire Cache (#368	Interior		
13	Fire Cache (#368)	Interior		